

Work Order ID 85989

85989

Page 1

June-19-12 1:16:48 PM

Item ID: D212-664-201TRN

Accept

N9000040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Crosstube Turning Detail

Start Date: 19/06/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 03/07/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: MLJ

Date: 12/06/19

Tooling:

Date:

Run Start *NR1*

QC:

Date:

SPC (Y/N):

Date:

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D212-664-241

Rev D

100

0.00

100

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs DT8534 on both ends as per Folio FA114

2-Turn first side as per Folio FA114

3-Blend transition lines only, **do not sand whole tube**:

FOLIO REV: AD

DWG REV: B

*Use mill bastard file, brush file repeatedly with file card.

*Do not use sandpaper coarser than 320 grit.

1 0

mand
12/06/12

110

QC1- Inspect dimensions to dimension sheet

0.00

110

QC

Memo

0.00

Quality Control

1 0

mm.L
12/06/12

Work Order ID 85989

June-19-12 1:16:48 PM

85989

Page 2

Item ID: D212-664-201TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 19/06/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 03/07/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

120

0.00

120

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Turn second side as per Folio FA114

2-Blend transition lines only, **do not sand whole tube**:

*Use mill bastard file, brush file repeatedly with file card.

*Do not use sandpaper coarser than 320 grit.

FOLIO REV: ADDWG REV: D

3-Remove sand and plugs

4- scribe batch # and part # as per dwg

130

0.00

130

QC

QC1- Inspect dimensions to dimension sheet

Memo

0.00

Quality Control

mmv
12/08/13mmv
12/08/13

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Supplier <input type="checkbox"/>		Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Other <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Supplier <input type="checkbox"/>																
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Other <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Offset/Setup									
Other									
Process									
Supplier									
Training									
Unauthorized									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending Passes Below Min <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimp at Bending <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Other <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Ripples on Inner Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	Hardware <input type="checkbox"/> Breaking <input type="checkbox"/> Missing <input type="checkbox"/> Size/Length <input type="checkbox"/> Spinning <input type="checkbox"/> Threading <input type="checkbox"/> Wrong Drill Holes <input type="checkbox"/> Misaligned <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Undersized <input type="checkbox"/> Too Many	General <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Documentation/Data <input type="checkbox"/> Finish <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Inspection Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Jigs/Fixtures/Tooling <input type="checkbox"/> Kit Incorrect <input type="checkbox"/> Kit Missing <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Off-Set <input type="checkbox"/> Orientation Misread <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Lost <input type="checkbox"/> Part Moved <input type="checkbox"/> Raw Material
---	--	---

- ☐ Set-up
- ☐ Supplier
- ☐ Temperature/Cure
- ☐ Weld
- ☐ Wrong Stock Pulled
- ☐ Other

Work-Order ID 85989

85989

Page 3

June-19-12 1:16:48 PM

Item ID: D212-664-201TRN

Accept

N900040100

Setup Start

NS1

Revision ID:

Item Name: Crosstube Turning Detail

Stop

NS2

Start Date: 19/06/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 03/07/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run

Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

140

QC8- Inspect parts - second check

0.00

140

QC

Memo

0.00

Quality Control

145

0.00

145

Crosstubes

Memo

0.00

Crosstubes

GRIND ONLY TRANSITION LINES SMOOTH LONGITUDE WAY.

150

~~Crosstubes Chemical Conversion~~

0.00

150

HandFXtube

Memo

0.00

Hand Finishing Crosstubes

1- Pressure wash x-tube inside and out
2- Acid Etch x-tube inside and out
Use red scotch brite.

JW

12-8-19

RM

RM

12-8-19

JW

12-8-16

DA
16
2-8-12

12/06/12

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width:100%; font-size: small;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Supplier <input type="checkbox"/>		Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Other <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Supplier <input type="checkbox"/>																
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Other <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Offset/Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unauthorized <input type="checkbox"/>									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending Passes Below Min <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimp at Bending <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Other <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Ripples on Inner Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	Hardware <input type="checkbox"/> Breaking <input type="checkbox"/> Missing <input type="checkbox"/> Size/Length <input type="checkbox"/> Spinning <input type="checkbox"/> Threading <input type="checkbox"/> Wrong Drill Holes <input type="checkbox"/> Misaligned <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Undersized <input type="checkbox"/> Too Many	General <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Documentation/Data <input type="checkbox"/> Finish <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Inspection Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Jigs/Fixtures/Tooling <input type="checkbox"/> Kit Incorrect <input type="checkbox"/> Kit Missing	<input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Off-Set <input type="checkbox"/> Orientation Misread <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Lost <input type="checkbox"/> Part Moved <input type="checkbox"/> Raw Material <input type="checkbox"/> Set-up <input type="checkbox"/> Supplier <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other _____ _____ _____
---	--	---	--

Work Order ID 85989

June-19-12 1:16:48 PM

85989

Page 4

Item ID: D212-664-201TRN

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Crosstube Turning Detail

Start Date: 19/06/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 03/07/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

160

160

QC

Quality Control

QC5 Inspect Chemical Conversion Coat

0.00

Memo

0.00

DAS 16 12/2/20

170

170

Packaging

Packaging

Packaging

Memo

Identify and stock in kanban rack
Location: LG

0.00

0.00

MO 12/8/20

180

180

QC

Quality Control

QC21- Final Inspection - Work Order Release

0.00

0.00

Memo

MLJ 12/08/20

MLJ 12/08/20

Picklist Print

June-19-12 1:16:52 PM

Page 1

Work Order ID: 85989

85989

Parent Item: D212-664-201TRN

D212-664-201TRN

Parent Item Name: Crosstube Turning Detail

Start Date: 19/06/2012

Required Date: 03/07/2012

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:A 08-03-06 new issue DD verified by:ec
IPP Rev B 08.04.02 Removed polish EC verified DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6006-129		Manufactured	No			120	Each	27.0000	1	1			

D6006-129

**

Crosstube Material

Location

Loc Qty

Loc Code

LG

27

23970

2

26550

3

34690

1

69838

21

mmL 12/08/11

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: *Ant*

Date: 12/08/12

QA Closed: *TC*

Date: 22/08/2012

Work Order: <u>85989</u> Part No. <u>D212-664-201TRN</u> NCR No. <u>12-1735</u>				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input checked="" type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input checked="" type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> Other <input type="checkbox"/> </div> <div> Engineering Quality <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input checked="" type="checkbox"/> Equip/Tooling <input checked="" type="checkbox"/> Operator <input type="checkbox"/> Material <input type="checkbox"/> Offset/Setup <input type="checkbox"/> Other <input type="checkbox"/> Process <input checked="" type="checkbox"/> Supplier <input type="checkbox"/> Training <input type="checkbox"/> Unauthorized <input type="checkbox"/>	12/4/15	100	1	Cuffs are under tolerance. 2.990" - 2.982" 2.993" - 2.984"	<i>DAS 12 89</i> 12/4/15	Acceptable	<i>DAS 12 89</i> 12/4/15	<i>DAS 16 89</i> 12/04/16	<i>DAS 16 89</i> 12/04/16		
FAULT CATEGORY											
Landing Gear			Hardware			General					
<input type="checkbox"/> Bending Passes Below Min <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimp at Bending <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Other <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Ripples on Inner Bend <input type="checkbox"/> Torque Waves in Extrusion <input checked="" type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			<input type="checkbox"/> Breaking <input type="checkbox"/> Missing <input type="checkbox"/> Size/Length <input type="checkbox"/> Spinning <input type="checkbox"/> Threading <input type="checkbox"/> Wrong Drill Holes <input type="checkbox"/> Misaligned <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Undersized <input type="checkbox"/> Too Many			<input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Documentation/Data <input type="checkbox"/> Finish <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Inspection Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Jigs/Fixtures/Tooling <input type="checkbox"/> Kit Incorrect <input type="checkbox"/> Kit Missing <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Off-Set <input type="checkbox"/> Orientation Misread <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Lost <input type="checkbox"/> Part Moved <input type="checkbox"/> Raw Material					
						<input type="checkbox"/> Set-up <input type="checkbox"/> Supplier <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other					


DART AEROSPACE LTD	Work Order:	85989
Description: Crosstube Assembly (205/212 High Aft)	Part Number:	D212-664-241
Inspection Dwg: D212-664-241 Rev: D		Page 1 of 2

FIRST ARTICLE INSPECTION CHECKLIST

	Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	0.200	+/-0.010	.200	✓		vern	CWC-08
	R0.063	+/-0.010	.063	✓		RG	
	2.990	+0.005/-0.000	2.990	✓		vern	CWC-08
	5.237	+/-0.030	5.237	✓			
	2.600	+0.005/-0.000	2.604	✓			
	2.686	+0.005/-0.000	2.690	✓			
	2.770	+0.005/-0.000	2.775	✓			
	2.854	+0.005/-0.000	2.859	✓			
	2.938	+0.005/-0.000	2.941	✓			
	3.021	+0.005/-0.000	3.026	✓			
	3.133	+0.005/-0.000	3.138	✓			
	3.179	+0.005/-0.000	3.183	✓			
SIDE B	0.200	+/-0.010	.200	✓		vern	CWC-08
	R0.063	+/-0.010	.063	✓		RG	
	2.990	+0.005/-0.000	2.992	✓		vern	CWC-08
	5.237	+/-0.030	5.237	✓			
	2.600	+0.005/-0.000	2.605	✓			
	2.686	+0.005/-0.000	2.691	✓			
	2.770	+0.005/-0.000	2.775	✓			
	2.854	+0.005/-0.000	2.859	✓			
	2.938	+0.005/-0.000	2.941	✓			
	3.021	+0.005/-0.000	3.026	✓			
	3.133	+0.005/-0.000	3.138	✓			
	3.179	+0.005/-0.000	3.182	✓			
	124.362	+/-0.020	124.360	✓		tape	LG-22

DART AEROSPACE LTD	Work Order:	85989
Description: Crosstube Assembly (205/212 High Aft)	Part Number:	D212-664-241
Inspection Dwg: D212-664-241 Rev: D		Page 2 of 2

WALL THICKNESS MEASUREMENT

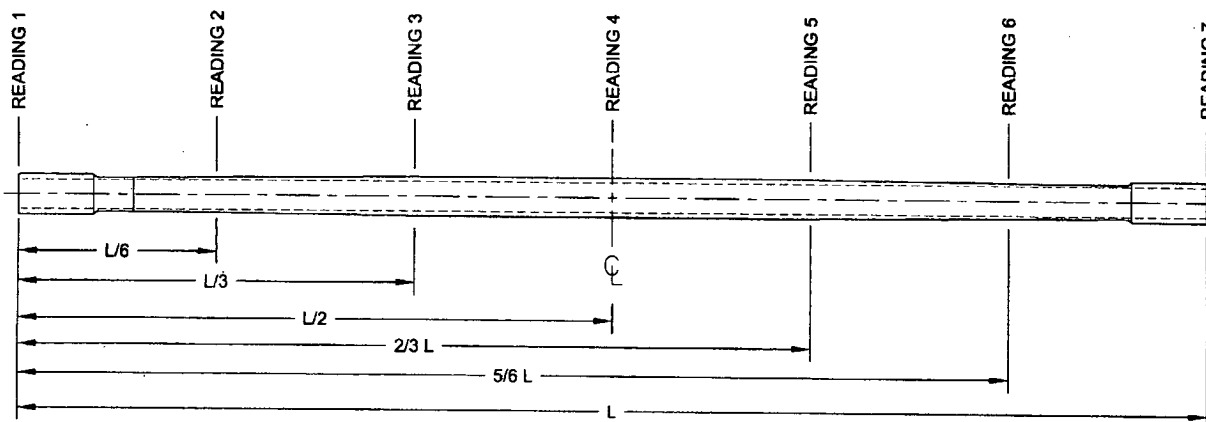

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L = 0"	.393	.381	.381	.393	.012	0.062"
READING 2 L = 15	.270	.270	.252	.254	.018	
READING 3 L = 30	.392	.394	.376	.373	.024	
READING 4 L = 62	.519	.516	.519	.518	.003	
READING 5 L = 30	.407	.381	.361	.382	.040	
READING 6 L = 15	.286	.257	.240	.270	.046	
READING 7 L = CUFF	.401	.366	.377	.402	.036	

Calibration Result

Actual Block Thickness: 250-750

Sitiescan 250 Measured Thickness: 250-750

Measured by: <u>mmml</u>	Audited by: <u>JW</u>	Preliminary Approval:
Date: <u>12/08/13</u>	Date: <u>12-8-16</u>	Date:

Rev	Date	Change	Revised by	Approved
A	05.04.27	New Issue (P/O D412-664-201)	KJ/JLM	
B	06.03.09	Tolerance for 5.237 was +/-0.001	KJ/JLM	
C	07.05.08	Dwg Rev. updated	KJ/JLM	
D	10.08.03	Dimension 124.362 was 124.36	KJ	
E	12.06.04	Wall thickness form added	KJ	

10

Item	Qty -241	Qty -241B	Part Number	Description
1	X		D212-664-241	CROSSTUBE ASSEMBLY (205/212 HIGH AFT)
2		X	D212-664-241B	CROSSTUBE ASSEMBLY (214 HIGH AFT)
3	1	1	D6006-129	CROSSTUBE
4	2	2	D2940-1	SUPPORT
5	4	4	D3595-063-530	RUBBER CUSHION
6	4	4	MS21920-28	CLAMP (OR MS21920-30)
7	A/R	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6006-129
FINISHED LENGTH = 124.362±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D212-664-XXX" AND BATCH NUMBER ON INSIDE OF CUFF
USING VIBRATING STYLUS.
- 7) WEIGHT: D212-664-241 = 44.2 lbs (PER IIN-D212-664)
D212-664-241B = 44.2 lbs (PER IIN-D212-664)
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 5 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING
IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2940-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE
OF D2940-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS
AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-28 CLAMPS (OR -30) WITH D3595-063-530 RUBBER CUSHIONS TO SECURE THE D2940-1
SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE
SUPPORT.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE
SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR
DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND
MARKS ARE UNACCEPTABLE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT
HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT

WITHOUT NOTICE

WORK ORDER

NO. 85909 MJS

12/06/19

UNDER REVIEW

DEO ATTACHED

RELEASED
2009-10-29

D	REFORMAT/REVISE GENERAL NOTES/PART LIST; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; ADD -241B (ZN D4-2, B4-2); REMOVED REF & ADD TOLERANCES (ZN D8-3 & C4-3; C6-3 & A8-3); RELOCATED FLAG #6 PER PAR 08-046 (ZN A5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4	RF	09.09.30
C	REMOVE -1009 ABRASION STRIP; ADD MAGNOBOND 6398, CUSHION, REVERSE CLAMPS	PH	07.03.08
B	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	PH	00.12.12
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	PH	DRAWING NO.	REV. D
MFG. APPR.	PH	D212-664-241	SHEET 1 OF 4
APPROVED	PH	TITLE	SCALE
DE APPR.	PH	CROSSTUBE ASSY (205/212 HI AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

12 13 15
 D2940-1 SUPPORT
 MS21920-28 CLAMP, 2X
 D3595-063-530 RUBBER CUSHION, 2X
 2 PL



14.00 (-241)
 OR 13.75 (-241B) $\triangle D$

D212-664-601
 BENT TUBE

SYM


D212-664-241/-241B
ASSEMBLY DETAIL $\triangle D$

UNDER REVIEW
 11.07.26
 11.06.13

DEO ATTACHED

RELEASED
 2009 -10- 28

12
 APPLY MAGNOBOND
 BETWEEN D2940-1 AND
 CROSSTUBE

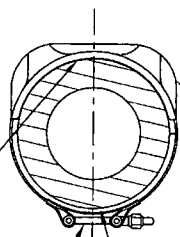


D2940-1 SUPPORT, REF

13 15
 MS21920-28
 CLAMP, REF


D3595-063-530 RUBBER CUSHION
 UNDER CLAMP, REF

SECTION A-A D6-2
 SCALE 4X


DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	92	DRAWING NO.	REV. D
MFG. APPR.	SS	D212-664-241	SHEET 2 OF 4
APPROVED	140	TITLE	SCALE
DE APPR.	14	CROSSTUBE ASSY (205/212 HI AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

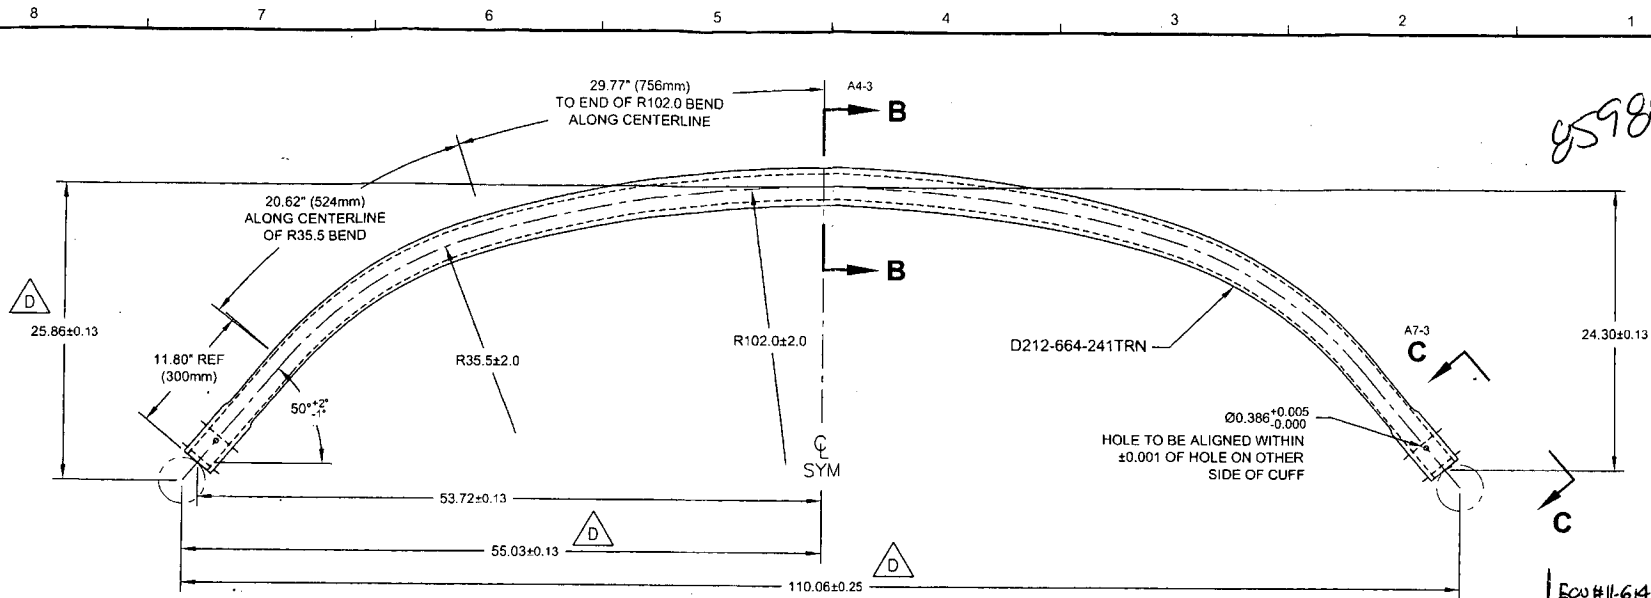

D212-664-601 10 D
BENDING AND DRILLING DETAIL

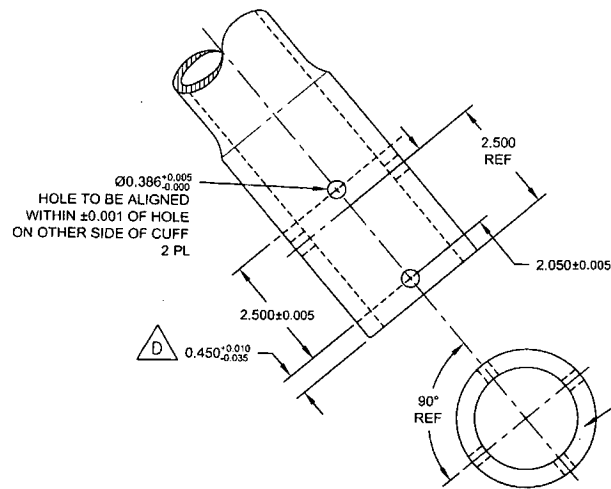

VIEW C-C: CUFF DETAIL D2-3
 SCALE 3X

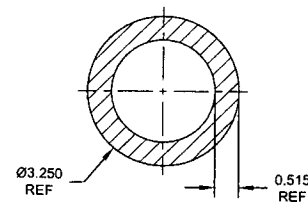

SECTION B-B D4-3
 SCALE 4X

ECU #11-614
 11.07.26

UNDER REVIEW
4/11/08

DEO ATTACHED

RELEASED
 2009-10-29


DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	9	DRAWING NO.	REV. D
MFG. APPR.	10	D212-664-241	SHEET 3 OF 4
APPROVED	11	TITLE	SCALE
DE APPR.	12	CROSSTUBE ASS'Y (205/212 HI AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

R100.0 TRANSITION
BETWEEN TAPERED
SECTIONS

R100.0 TRANSITION
BETWEEN TAPERED
SECTIONS

0.515 WALL
STOCK, REF

SEE DETAIL D

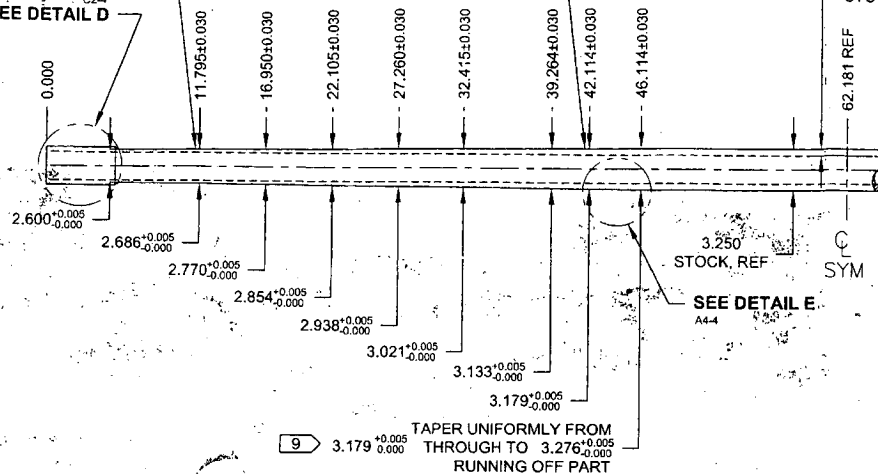

SEE DETAIL E

9
30° X 0.500 DEEP
CHAMFER

R0.063

SEE DETAIL F

DETAIL D:
CROSSTUBE CUFF
SCALE 5X



200811-614
11.07.28

UNDER REVIEW

DEO ATTACHED

RELEASED
2009-10-29

D212-664-241TRN
TURNING DETAIL

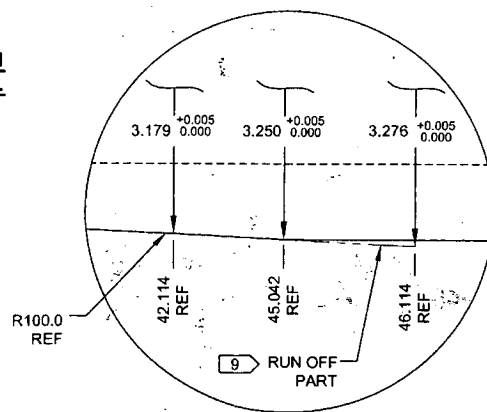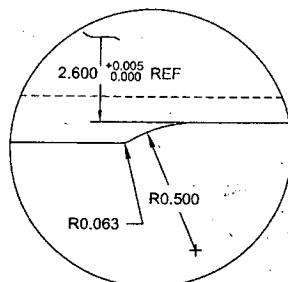

DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	DS	DRAWING NO.	REV. D
MFG. APPR.	DS	D212-664-241	SHEET 4 OF 4
APPROVED	AP	TITLE	SCALE
DE APPR.	AP	CROSSTUBE ASS'Y (205/212 HI AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

05989

DRAWING NO. D212-664-241	TITLE CROSSTUBE ASSY (205/212 HI AFT)	REV. D	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D212-664-241-D-1	SHEET NO. SHEET 1 OF 2	SCALE NTS
DRAWN	CHECKED	MFG. APPR.	APPROVED	DE APPR.			
DATE 11.04.07	DATE 11.04.11	DATE 11.04.12	DATE 11/04/12	DATE 11.04.12			

PURPOSE:

ADD AN INSPECTION WINDOW TO UNDERSIDE OF CROSSTUBE.

CHANGE:

NOTES 2 OF SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (HATCHED AREA) AND
PAINT OUTSIDE PER DART QSI 005 4.2
REMOVE MASKING AND APPLY CLEAR COAT

WAS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2

RELEASED
2011-04-18

UNDER REVIEW

11.16.13

ECN#1-614


11.07.20

85989

DRAWING NO. D212-664-241	TITLE CROSSTUBE ASSY (205/212 HI AFT)	REV. D	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D212-664-241-D-1	SHEET NO. SHEET 2 OF 2	SCALE NTS
DRAWN	CHECKED	MFG. APPR.	APPROVED	DE APPR.			
DATE 11.04.07	DATE 11.04.11	DATE 11.04.12	DATE 11/04/12	DATE 11.04.12			


IS:

WAS:

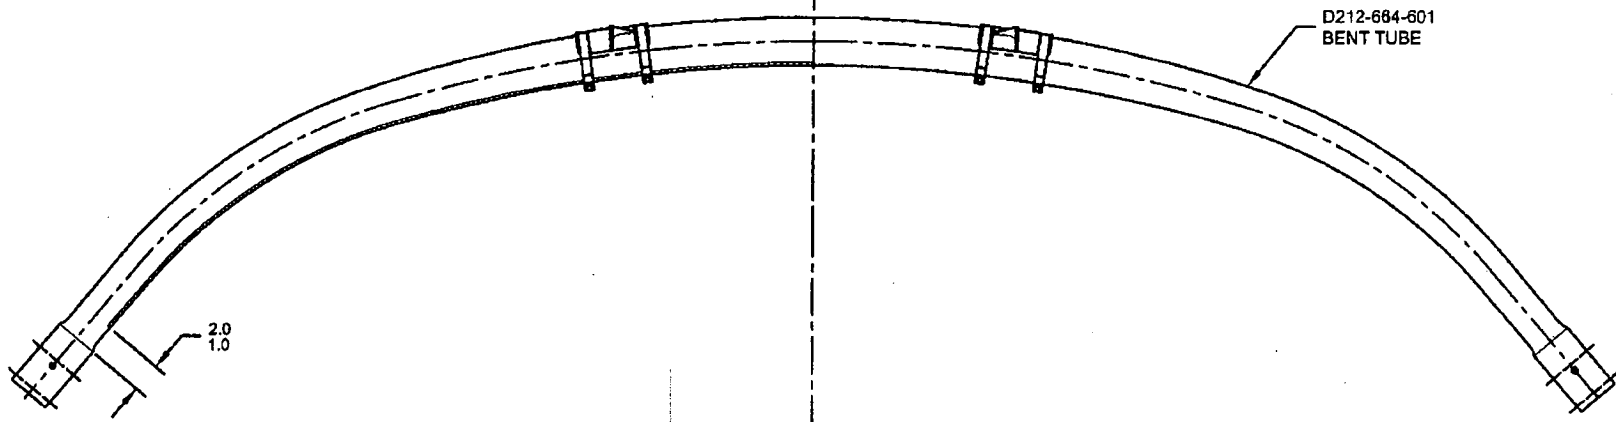

**D212-664-241/-241B
ASSEMBLY DETAIL**

MASK AREA PRIOR TO PAINTING,
REMOVE MASKING AFTER PAINT
AND APPLY CLEAR COAT

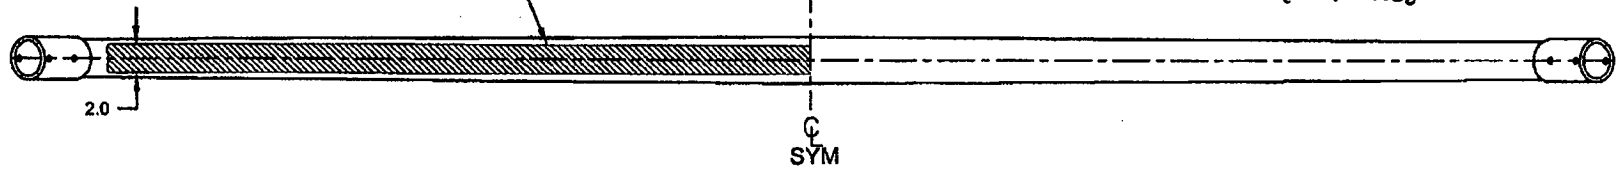

RELEASED
2011-04-18

UNDER REVIEW
11.06.13
11.07.12

05989

DRAWING NO. D212-664-241	TITLE CROSSTUBE ASS'Y (205/212 HI AFT)	REV. D	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D212-664-241-D-2	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>q</i>	CHECKED <i>ASS</i>	MFG. APPR. <i>BS</i>	APPROVED <i>MD</i>		DE APPR. <i>MD</i>		
DATE 11.07.15	DATE 11.07.20	DATE 11.07.21	DATE 11.07.21		DATE 11.07.21		

PURPOSE:

REPLACE MAGNOBOND WITH PROSEAL.

CHANGE:

IS:

Item	Qty -241	Qty -241B	Part Number	Description
7	A/R	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

WAS:

7	A/R	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
---	-----	-----	----------------	---

NOTE 12 & 15, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) TO INSTALL D2940-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. **PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.**

WAS:

- 12) INSTALL D2940-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2940-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RELEASED
2011-07-28
MD

